

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

**Primary #**  
**HRI #**  
**Trinomial**  
**NRHP Status Code** 5B; GR No. 26 (clock tower only)

**Other Listings** Brockmont Park Historic District – Contributor

**Review Code**                      **Reviewer**                      **Date**

Page 1 of 2

**\*Resource Name or #:** 1605 ARBOR DR

**P1. Other Identifier:**

**\*P2. Location:**  Not for Publication  Unrestricted

**\*a. County:** Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

**\*b. USGS 7.5' Quad:** Burbank    **Date:** 1966, photorevised 1972, minor revision 1994    **T R of of Sec B.M.**

c. Address: 1605 Arbor Drive

City: Glendale

Zip: 91202

d. UTM: Zone:                      ;                      mE/                      mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-010-007

**\*P3a. Description:** (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

Note: House is not visible from the street. Clock tower partially visible from driveway and other locations.

**Architectural Style:** Craftsman with Spanish Colonial Revival influences

**Siding:** smooth stucco

**Roof:** cross-gabled; clay tile; exposed rafter tails

**Windows:** divided-light wood casement and double-hung windows; single-light wood casement and fixed windows

**Primary Entrance:** broad entry porch with concrete steps flanked by covered side porches that angle out from main body; glazed wood door

**Chimney:** smooth stucco at interior (2)

**Garage:** detached five-car garage

**Other Notable Features:** deep roof eaves with long exposed beams at gable ends and exposed rafter tails; decorative attic vents at gable ends; multiple domed turrets that pierce roof at most building corners; buttresses at extreme end of side porches; battered building base in some locations; shallow segmental arches at head of porch openings; stucco retaining walls and piers delineate patios and landscaped areas, many featuring globe light fixtures with concrete bases

Clock tower (1914; Glendale Register No. 26): Four-story clock tower of similar design to main house

**Plan:** asymmetrical

**No. Stories:** 2


**Alterations:** garage added (1998)

**Integrity:** high due to retention of character-defining features

**\*P3b. Resource Attributes:** (List attributes and codes) HP2. Single-family property

**\*P4. Resources Present:**  Building     Structure     Object     Site     District     Element of District     Other (Isolates, etc.)

**P5a. Photo or Drawing**

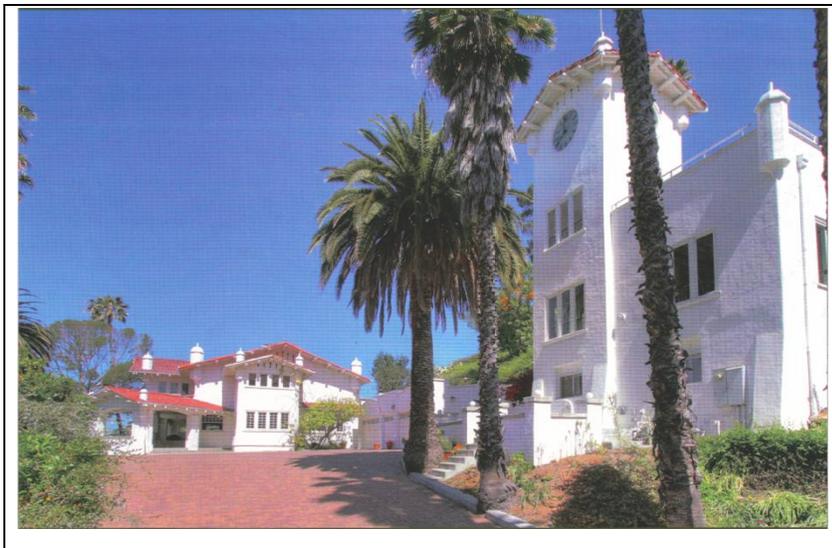

**P5b. Description of Photo:** (View, date, accession #) View to west, 3/27/2012

**\*P6. Date Constructed/Age and Sources:**

Historic     Prehistoric     Both

1910

Los Angeles County Assessor

**\*P7. Owner and Address:**

**\*P8. Recorded by:** (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

**\*P9. Date Recorded:** January 2013

**\*P10. Survey Type:** (Describe)

Historic District Evaluation

**\*P11. Report Citation:**

**\*Attachments:**  NONE     Location Map     Sketch Map     Continuation Sheet     Building, Structure, and Object Record  
 Archaeological Record     District Record     Linear Feature Record     Milling Station Record     Rock Art Record  
 Artifact Record     Photograph Record     Other (List):



Clock tower, view to west, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor  
Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 1609 ARBOR DR

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 1609 Arbor Drive

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-011-010

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Spanish Colonial Revival

**Siding:** smooth stucco

**Roof:** gabled/hipped; clay tile

**Windows:** prominent bay over garage with stained and leaded glass and decorative wood paneling and spindles; fixed round accent windows with decorative leaded glass at entry porch, steel casement windows at other locations

**Primary Entrance:** recessed opening with splayed jambs and head; wood door with segmental arch, metal clavos, and small square glazed openings; open landing accessed by stairs

**Chimney:** smooth stucco at interior

**Garage:** attached (below body of house); glazed wood infill

**Other Notable Features:** wraparound balcony supported by decorative beam ends and featuring elaborate turned columns; decorative wood railings with geometric cutouts; enclosed side yard

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** addition at north façade; various window replacements; garage opening infill (all dates unknown)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to north, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1930

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206


\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

**Attachments:**  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):

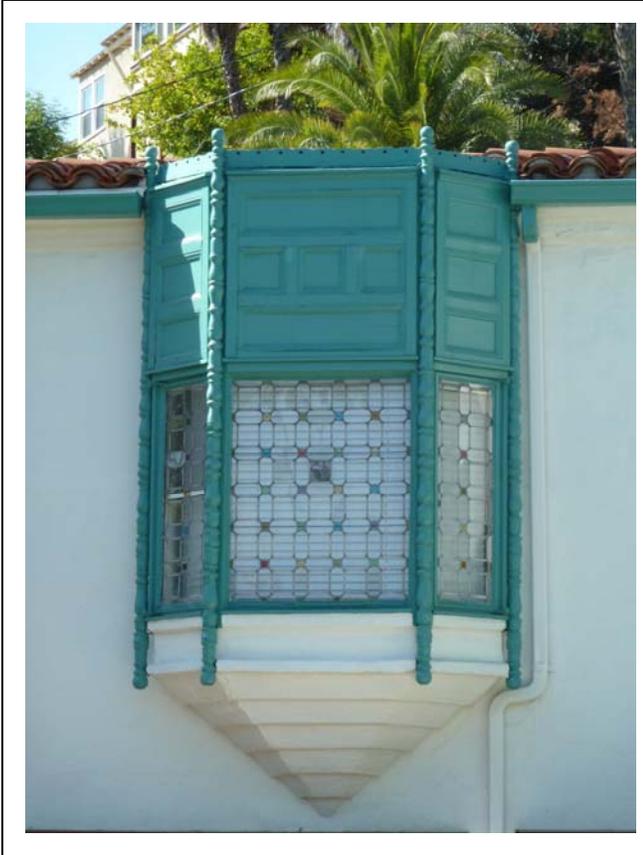

Detail of oriel window, view to north, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 1615 ARBOR DR

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 1615 Arbor Drive

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-011-009

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Monterey Revival

**Siding:** smooth stucco

**Roof:** shed, flat with parapet; clay tile

**Windows:** four sets of wood French doors with full-height decorative shutters open onto first- and second-story porches; wood divided-light casement windows with decorative shutters at second story

**Primary Entrance:** glazed wood door

**Chimney:** smooth stucco at side façade

**Garage:** detached

**Other Notable Features:** chamfered wood posts with corbels at front façade; ornamental brackets at front shed roof

**Plan:** symmetrical

**No. Stories:** 2

**Alterations:** addition at rear first story (1986); addition at rear second story (1998); garage door replaced (date unknown)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #)

View to north, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1927

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front and side elevation, view to north, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

**Primary #**  
**HRI #**  
**Trinomial**  
**NRHP Status Code** 7DNC

**Other Listings** Brockmont Park Historic District – Non-Contributor  
**Review Code**                      **Reviewer**                      **Date**

Page 1 of 2

\*Resource Name or #: 1621 ARBOR DR

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank      Date: 1966, photorevised 1972, minor revision 1994      T R of of Sec B.M.

c. Address: 1621 Arbor Drive

City: Glendale

Zip: 91202

d. UTM: Zone:      ;      mE/      mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-011-014

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Ranch

**Siding:** brick; smooth stucco at second story of projecting wing

**Roof:** hipped; asphalt shingle

**Windows:** prominent bay window with divided lights, parallel base, and metal roof; French doors with sidelights; divided-light casement windows at projecting wing

**Primary Entrance:** double doors with decorative metal grilles (non-original)

**Chimney:** brick at interior

**Garage:** attached

**Other Notable Features:** wide, overhanging, boxed eaves

**Plan:** asymmetrical

**No. Stories:** 1

**Alterations:** extensively remodeled; entry porch reconfigured; French doors added; garage doors replaced; brick cladding added; driveway repaved in brick (all dates unknown)

**Integrity:** low due to extensive alterations

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building     Structure     Object     Site     District     Element of District     Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #)

View to north, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic     Prehistoric     Both

1955

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE     Location Map     Sketch Map     Continuation Sheet     Building, Structure, and Object Record  
 Archaeological Record     District Record     Linear Feature Record     Milling Station Record     Rock Art Record  
 Artifact Record     Photograph Record     Other (List):



Front elevation, view to north, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor  
Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 1627 ARBOR DR

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 1627 Arbor Drive

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-011-013

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Colonial Revival

**Siding:** smooth stucco

**Roof:** side-gabled; asphalt shingle

**Windows:** wood divided-light double-hung windows with decorative shutters at first and second stories; wood bay window at single-story wing at north; small rectangular window to the left of recessed entry

**Primary Entrance:** recessed arched entry; wood-paneled door flanked by sidelights and fanlight at transom

**Chimney:** brick at side façade

**Garage:** detached

**Other Notable Features:** simple dentiled cornice band under eave; terrace with wood railing above north wing

**Plan:** symmetrical

**No. Stories:** 2

**Alterations:** asphalt shingle reroof (2006)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



\*P5b. Description of Photo: (View, date, accession #)

View to north, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1938

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front elevation, view to north, 3/27/2012



Front and side elevation, detached garage, view to north, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

**Primary #**  
**HRI #**  
**Trinomial**  
**NRHP Status Code** 5D1

**Other Listings** Brockmont Park Historic District – Contributor

**Review Code**                      **Reviewer**                      **Date**

Page 1 of 2

**\*Resource Name or #:** 300 CUMBERLAND RD

**P1. Other Identifier:**

**\*P2. Location:**  Not for Publication  Unrestricted

**\*a. County:** Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

**\*b. USGS 7.5' Quad:** Burbank    **Date:** 1966, photorevised 1972, minor revision 1994    **T R of of Sec B.M.**

c. Address: 300 Cumberland Road

City: Glendale

Zip: 91202

d. UTM: Zone:            ;            mE/            mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-022-009

**\*P3a. Description:** (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Ranch

**Siding:** horizontal wood above stucco wainscot; brick adjacent to entryway

**Roof:** gable-on-hip; composite shingle

**Windows:** wood divided-light double-hung windows with decorative shutters; metal greenhouse window at front façade; small arched window with arched shutters at west façade

**Primary Entrance:** recessed entry with painted brick surround; glazed wood door

**Chimney:** painted brick at central front façade

**Garage:** attached

**Other Notable Features:** heavy brick door surround

**Plan:** asymmetrical

**No. Stories:** 1

**Alterations:** swimming pool (1976); west façade addition (1980); greenhouse window (date unknown)

**Integrity:** high due to retention of character-defining features

**\*P3b. Resource Attributes:** (List attributes and codes) HP2. Single-family property

**\*P4. Resources Present:**  Building     Structure     Object     Site     District     Element of District     Other (Isolates, etc.)

**P5a. Photo or Drawing**



**\*P5b. Description of Photo:** (View, date, accession #) View to south, 3/27/2012

**\*P6. Date Constructed/Age and Sources:**

Historic     Prehistoric     Both

1951

Los Angeles County Assessor

**\*P7. Owner and Address:**

**\*P8. Recorded by:** (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

**\*P9. Date Recorded:** January 2013

**\*P10. Survey Type:** (Describe)

Historic District Evaluation

**\*P11. Report Citation:**

**\*Attachments:**  NONE     Location Map     Sketch Map     Continuation Sheet     Building, Structure, and Object Record  
 Archaeological Record     District Record     Linear Feature Record     Milling Station Record     Rock Art Record  
 Artifact Record     Photograph Record     Other (List):



Detail of greenhouse window, view to south, 3/27/2012



Front elevation, view to south, 3/27/2012



Front and side elevation, view to south, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor  
Review Code Reviewer Date

Page 1 of 1

\*Resource Name or #: 301 CUMBERLAND RD

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 301 Cumberland Road

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-012-001

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Ranch with Tudor Revival influences

**Siding:** horizontal wood; brick and stucco wainscots

**Roof:** gable-on-hip; composite shingle; exposed rafter tails; flared eaves

**Windows:** divided-light steel casement windows, some with leaded diamond panes, transom, and colored accidentals

**Primary Entrance:** recessed entry; glazed wood door

**Chimney:** brick at central front façade

**Garage:** attached with replacement door

**Other Notable Features:** prominent brick chimney with shoulders and sculptural crown at front façade; shed dormer; cupola; leaded glass windows; dovescote attic vents; semi-circular driveway; porte cochere; brick gate posts

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** wood shake roof replaced (date unknown)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to south, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1953

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):

P



Front elevation, view to south, 3/27/2012



Side elevation, view to east, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

**Primary #**  
**HRI #**  
**Trinomial**  
**NRHP Status Code** 5D1

**Other Listings** Brockmont Park Historic District – Contributor

**Review Code**                      **Reviewer**                      **Date**

Page 1 of 2

\***Resource Name or #:** 314 CUMBERLAND RD

**P1. Other Identifier:**

\***P2. Location:**  Not for Publication  Unrestricted

\***a. County:** Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\***b. USGS 7.5' Quad:** Burbank    **Date:** 1966, photorevised 1972, minor revision 1994    **T R of of Sec B.M.**

c. Address: 314 Cumberland Road

City: Glendale

Zip: 91202

d. UTM: Zone:            ;            mE/            mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-022-015

\***P3a. Description:** (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Spanish Colonial Revival

**Siding:** smooth stucco

**Roof:** cross-gabled; clay tile

**Windows:** wood divided-light casement windows, some covered by wrought-iron grilles; replacement windows at arch-headed and square openings at front façade

**Primary Entrance:** recessed entry porch; single door

**Chimney:** stucco with decorative shroud at side façade

**Garage:** attached three-car with shed roof and arched entryways

**Other Notable Features:** wrought-iron balconet

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** window openings (1933); sunroom addition (1935); swimming pool and retaining wall (1972); three-car garage and rear addition (2000); window replacements (date unknown)

**Integrity:** high due to retention of character-defining features

\***P3b. Resource Attributes:** (List attributes and codes) HP2. Single-family property

\***P4. Resources Present:**  Building     Structure     Object     Site     District     Element of District     Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to north, 3/27/2012

\***P6. Date Constructed/Age and Sources:**

Historic     Prehistoric     Both

1927

Los Angeles County Assessor

\***P7. Owner and Address:**

\***P8. Recorded by:** (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\***P9. Date Recorded:** January 2013

\***P10. Survey Type:** (Describe)

Historic District Evaluation

\***Attachments:**  NONE     Location Map     Sketch Map     Continuation Sheet     Building, Structure, and Object Record  
 Archaeological Record     District Record     Linear Feature Record     Milling Station Record     Rock Art Record  
 Artifact Record     Photograph Record     Other (List):



Front elevation, view to north, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 321 CUMBERLAND RD

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 321 Cumberland Road

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-010-006

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Ranch

**Siding:** textured stucco; brick; board-and-batten

**Roof:** cross-gabled; asphalt shingle; exposed rafter tails; open eaves

**Windows:** wood divided-light fixed, double-hung, and casement with x-shaped panes; some windows feature decorative wood plank shutters

**Primary Entrance:** recessed porch under main roof; glazed wood door; decorative beam and exaggerated support brackets

**Chimney:** brick at interior

**Garage:** attached

**Other Notable Features:** decorative wood shutters; prominent decorative brackets at roof; decorative dovescotes in gable ends; decorative asymmetrical gable and bracketed shelf at west façade

**Plan:** asymmetrical

**No. Stories:** 1


**Alterations:** swimming pool and retaining wall (1961); rear addition (1985); asphalt shingle reroof (2001); garage door replaced (date unknown)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**

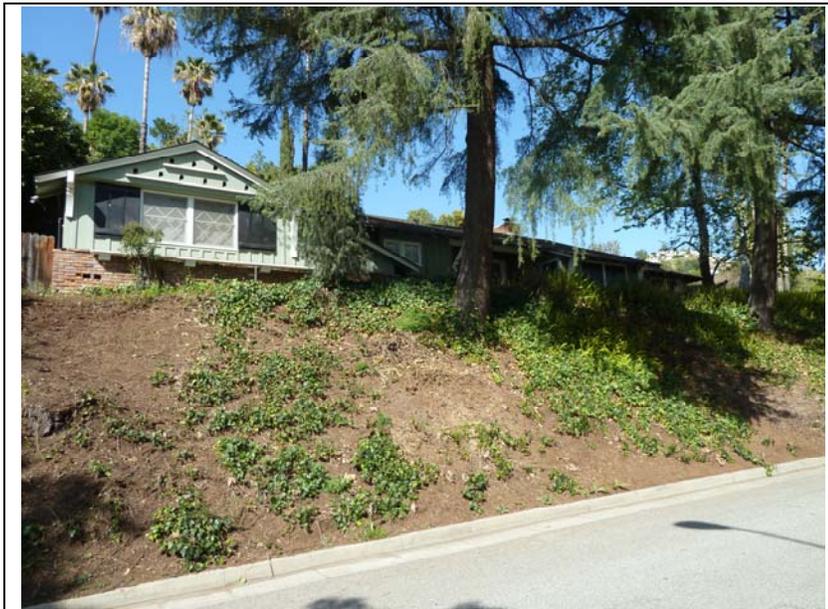

**P5b. Description of Photo:** (View, date, accession #) View to south, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1952

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)


Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front elevation, view to south, 3/27/2012

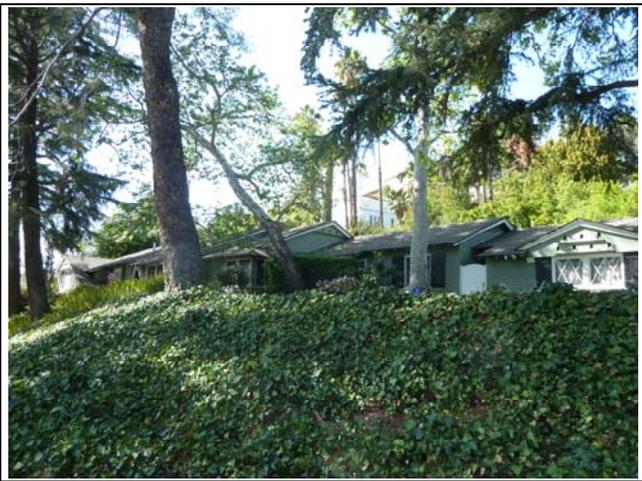

Front elevation, view to south, 3/27/2012



Side elevation, view to east, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 326 CUMBERLAND RD

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 326 Cumberland Road

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-022-012

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Spanish Colonial Revival

**Siding:** smooth stucco

**Roof:** hipped, gabled; clay tile

**Windows:** steel divided-light casement windows; tall focal windows with segmental arch head; pair of windows with arched transoms and small leaded glass lights; many window openings feature deep recess

**Primary Entrance:** recessed entry with paneled wood door

**Chimney:** smooth stucco at interior (2)

**Garage:** attached with clay tile roof

**Other Notable Features:** arched porte cochere; oriel with elaborate decorative woodwork and paneling; second-story balcony with decorative cast iron and turned-wood posts supported by heavy corbels; projecting second-story with prominent stucco corbels; stucco cornice

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** swimming pool (1954); chimney repair (1971); pool house at rear (1975)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to north, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1930

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)


Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front elevation, view to north, 3/27/2012

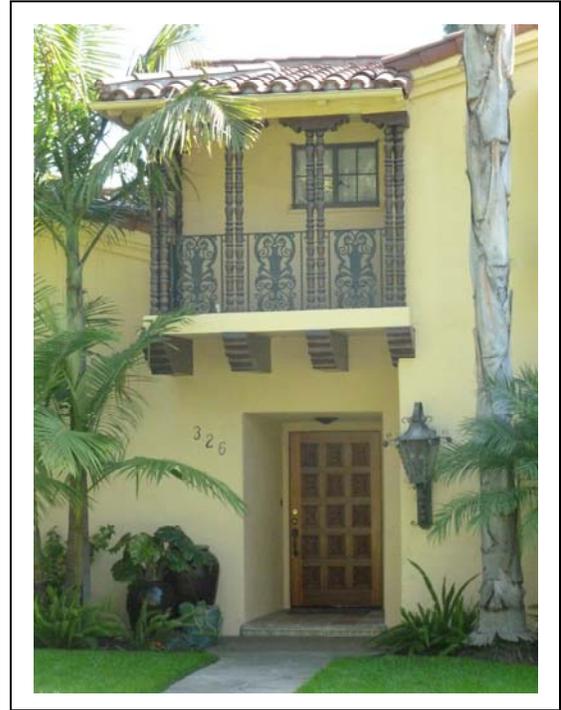

Detail of front entry and balcony, view to north, 3/27/2012



Front elevation, view to north, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 332 CUMBERLAND RD

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 332 Cumberland Road

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-022-013

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Spanish Colonial Revival

**Siding:** rough-textured stucco at first story; horizontal wood at second story

**Roof:** hipped, gabled; clay tile

**Windows:** wood divided-light French doors with iron balconet above garage; vinyl hung and sliding windows at first story; divided-light steel casement windows at second story

**Primary Entrance:** recessed entry; glazed wood door

**Chimney:** brick at side façade

**Garage:** attached, below grade

**Other Notable Features:**

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** rear porch enclosed (1949); swimming pool (1956); rear addition (1988); windows reconfigured (2008); various windows replaced (date unknown); canvas awnings installed (date unknown)

**Integrity:** moderate due to additions visible from the street and loss of some character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to north, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1936

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Detail of front wing, view to north, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 7DNC

Other Listings Brockmont Park Historic District – Non-Contributor  
Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 333 CUMBERLAND RD

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 333 Cumberland Road

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-010-005

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Ranch

**Siding:** horizontal wood; stucco; painted brick at garage

**Roof:** side-gabled; asphalt shingle

**Windows:** steel casement and fixed windows with decorative shutters; round wood accent window with cobweb-pattern muntins; wood divided-light French doors and iron balconet above garage door

**Primary Entrance:** recessed entry with glazed wood door and sidelight

**Chimney:** brick at interior

**Garage:** attached

**Other Notable Features:** wall dormer above French doors; skewed soldier bricks at top of chimney

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** front steps removed (1955); retaining wall (1956); reroof (1984); front porch reconfiguration (date unknown); window replacements (date unknown); garage door replacement (unknown)

**Integrity:** low due to extensive alterations

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to south, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1954

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front elevation, view to south, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 340 CUMBERLAND RD

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 340 Cumberland Road

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-022-103

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Ranch with Tudor Revival influences

**Siding:** horizontal wood; brick; smooth stucco

**Roof:** cross-gabled; asphalt shingle

**Windows:** steel divided-light bay, casement, and fixed windows, some with diamond panes; diamond-pane clerestory

**Primary Entrance:** brick entry porch; recessed door; wood columns with bracketed capitals

**Chimney:** brick at interior

**Garage:** attached

**Other Notable Features:** bay window with metal roof; vented gable above bay window; vented shed dormer

**Plan:** asymmetrical

**No. Stories:** 1

**Alterations:** sunroom at rear (1950); retaining wall (1953)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to north, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1951

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):

CONTINUATION SHEET



Front elevation, view to north, 3/27/2012



Side elevation, view to west, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 7DNC

Other Listings Brockmont Park Historic District – Non-Contributor  
Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 341 CUMBERLAND RD

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 341 Cumberland Road

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-010-008

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Ranch

**Siding:** smooth stucco; board-and-batten; horizontal wood

**Roof:** cross-gabled; asphalt shingle

**Windows:** steel divided-light casement windows, some with leaded diamond panes; louvered glass windows at side

**Primary Entrance:** recessed; wood door with diamond-pane light

**Chimney:** none visible from street

**Garage:** attached

**Other Notable Features:** decorative extended eave supported by angled wood bracket

**Plan:** symmetrical

**No. Stories:** 1

**Alterations:** retaining wall (1989)

**Integrity:** high due to retention of character-defining features; non-contributing due to construction date outside district period of significance

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



\*P5b. Description of Photo: (View, date, accession #) View to south, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1959

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department  
Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front elevation, view to south, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 7DNC

Other Listings Brockmont Park Historic District – Non-Contributor

Review Code Reviewer Date

Page 1 of 1

\*Resource Name or #: 349 CUMBERLAND RD

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 349 Cumberland Road

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-010-004

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

Architectural Style: Modern

Siding: smooth stucco

Roof: hipped; asphalt shingle

Windows: sliding and fixed vinyl windows with internal grids

Primary Entrance: glazed wood door with sidelights

Chimney: prominent stucco at front façade

Garage: attached

Other Notable Features:

Plan: asymmetrical

No. Stories: 2

Alterations: laundry room addition (1958); second-floor addition (1966); window replacements (date unknown); entry door (date unknown); tile pavers at entry stair (date unknown)

Integrity: moderate due to alterations visible from the street and loss of some character-defining features; non-contributing due to construction date outside district period of significance

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to east, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1953

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front elevation, view to east, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 356 CUMBERLAND RD

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 356 Cumberland Road

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-010-003

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Spanish Colonial Revival

**Siding:** smooth stucco

**Roof:** gabled with conical at stair tower; clay tile

**Windows:** wood divided-light casement and fixed windows; wood oriel with spindles; recessed, arched French doors

**Primary Entrance:** wood door in recessed splayed opening with flat arch

**Chimney:** stucco at side façade

**Garage:** attached two-car with arched door openings and clay tile roof

**Other Notable Features:** slight projection of second story creates a narrow arcade edged by open arches; cylindrical stair tower; second-story balcony with wood balustrade and posts; round vents covered by decorative grilles; decorative brackets at roof; wrought-iron light fixtures; headers at various windows

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** garage addition (1933); elevator shaft (1935); swimming pool (1980); side yard enclosure (date unknown); driveway paved in brick (date unknown)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



\*P5b. Description of Photo: (View, date, accession #) View to west, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1928

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front elevation, view to west, 3/27/2012



Detail of attached garage, view to west, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 7DNC

Other Listings Brockmont Park Historic District – Non-Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 357 CUMBERLAND RD

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 357 Cumberland Road

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-010-003

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Ranch

**Siding:** smooth stucco

**Roof:** cross-gabled; composite shingle

**Windows:** non-original fixed and casement windows

**Primary Entrance:** recessed entry accessed by stairs; paneled door with arched light

**Chimney:** brick at interior

**Garage:** attached

**Other Notable Features:**

**Plan:** asymmetrical

**No. Stories:** 1 and 2

**Alterations:** addition above garage (2006); window replacements (date unknown); garage door replacement (date unknown)

**Integrity:** low due to extensive alterations

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to east, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both  
1954

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department  
Planning Division

633 E Broadway, Room 103  
Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front elevation, view to east, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 359 CUMBERLAND RD

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 359 Cumberland Road

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-010-002

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Ranch

**Siding:** wood shingle; stucco; brick

**Roof:** cross-gabled; asphalt shingle; exposed rafter tails

**Windows:** wood divided-light fixed, casement, and double-hung windows with diamond and rectangular panes

**Primary Entrance:** recessed entry; glazed wood door with diamond panes

**Chimney:** brick at interior

**Garage:** attached

**Other Notable Features:** asymmetrical gable roof at garage wing; diamond-paned door light and windows; corner window on brackets; slight projection supported by heavy brackets at left façade

**Plan:** asymmetrical

**No. Stories:** 1

**Alterations:** retaining wall (1955); wood shake roof replaced (1983); re-faced with brick and wood shingle siding (date unknown)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to east, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1955

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front elevation, view to east, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 1

\*Resource Name or #: 361 CUMBERLAND RD

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 361 Cumberland Road

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-010-002

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Spanish Colonial Revival

**Siding:** smooth stucco with textured accents

**Roof:** cross-gabled, hipped octagonal; clay tile

**Windows:** steel divided-light casement at first and second story; recessed picture window with bell cast arch head and wrought-iron balconet at projecting wing; narrow recessed arched window with stained glass at tower

**Primary Entrance:** entry arcade; decorative wood door

**Chimney:** stucco at interior

**Garage:** detached with hipped clay-tile roof

**Other Notable Features:** decorative pent gable below roof gable at projecting wing (both with decorative fascia); decorative wing walls at front of projecting wing; octagonal tower with stucco cornice and deeply-recessed vents featuring wrought-iron grille; cupola above tower; second-story porch with turned wood columns; wrought-iron railing; statuary niche

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** rear balcony enclosed (1962)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to west, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1933

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Side elevation, view to west, 3/27/2012



Detail of detached garage, view to west, 3/27/2012



Detail of picture window, view to north, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

**Primary #**  
**HRI #**  
**Trinomial**  
**NRHP Status Code** 5D1

**Other Listings** Brockmont Park Historic District – Contributor

**Review Code**                      **Reviewer**                      **Date**

Page 1 of 2

**\*Resource Name or #:** 305 W KENNETH RD

**P1. Other Identifier:**

**\*P2. Location:**  Not for Publication  Unrestricted

**\*a. County:** Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

**\*b. USGS 7.5' Quad:** Burbank    **Date:** 1966, photorevised 1972, minor revision 1994    **T R of of Sec B.M.**

c. Address: 305 W Kenneth Road

City: Glendale

Zip: 91202

d. UTM: Zone:            ;            mE/            mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-023-005

**\*P3a. Description:** (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Mediterranean Revival

**Siding:** smooth stucco

**Roof:** hipped, clay tile; open eaves; cornice line brackets

**Windows:** wood casement (some with iron grille or decorative shutters); wood bay at first floor; two sets of wood second-floor French doors with iron balconets

**Primary Entrance:** recessed entry with decorative stucco door surround; single wood door with segmental arch and balconet above

**Chimney:** smooth stucco with triangular chimney shroud at interior

**Garage:** attached three-car

**Other Notable Features:** decorative door surround; grilled window with stucco hood at ground floor; copper downspouts; expansive sloping front lawn with mature palms and other trees; stucco-clad piers with decorative lamps at driveway entrance; curved driveway and motor court

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** garage addition (1936); compatible window replacements (date unknown)

**Integrity:** high due to retention of character-defining features

**\*P3b. Resource Attributes:** (List attributes and codes) HP2. Single-family property

**\*P4. Resources Present:**  Building     Structure     Object     Site     District     Element of District     Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to north, 3/27/2012

**\*P6. Date Constructed/Age and Sources:**

Historic     Prehistoric     Both

1934

Los Angeles County Assessor

**\*P7. Owner and Address:**

**\*P8. Recorded by:** (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

**\*P9. Date Recorded:** January 2013

**\*P10. Survey Type:** (Describe)

Historic District Evaluation

**\*P11. Report Citation:**

**\*Attachments:**  NONE     Location Map     Sketch Map     Continuation Sheet     Building, Structure, and Object Record  
 Archaeological Record     District Record     Linear Feature Record     Milling Station Record     Rock Art Record  
 Artifact Record     Photograph Record     Other (List):



Side elevation, view to west, 3/27/2012



Detail of attached garage, view to west, 3/27/2012



Side elevation, view to west, 3/27/2012



Side elevation, view to north, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 325 W KENNETH RD

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 325 W Kenneth Road

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-023-004

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Spanish Colonial Revival

**Siding:** smooth stucco

**Roof:** shed and front- and side-gabled; clay tile; exposed rafter tails

**Windows:** wood divided-light casement windows; most second-floor windows have deeper recess

**Primary Entrance:** entry arcade; single wood door

**Chimney:** none visible from street

**Garage:** detached with clay-tile gabled roof

**Other Notable Features:** arcade clay-tile shed roof; wing wall with half-arched opening at side yard

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** unknown

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



\*P5b. Description of Photo: (View, date, accession #) View to south, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1935

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front elevation, view to south, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor  
Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 329 W KENNETH RD

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 329 W Kenneth Road

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-023-003

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Monterey Revival

**Siding:** smooth stucco; vertical wood at front balcony; horizontal wood at side gables

**Roof:** side-gabled; asphalt shingle

**Windows:** divided-light double-hung windows with decorative shutters at first story; small divided-light casement windows at second story; three sets of French doors at second-floor balcony (all wood)

**Primary Entrance:** recessed entry; glazed wood door

**Chimney:** smooth stucco at interior; brick at interior

**Garage:** detached

**Other Notable Features:** projecting full-length balcony with wood posts and criss-cross railing supported by brackets; recessed paneled entryway; brick retaining wall

**Plan:** symmetrical

**No. Stories:** 2

**Alterations:** chimney rebuilt (1971); reroof (1996)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to south, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1934

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Detail of front entry, view to south, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

**Primary #**  
**HRI #**  
**Trinomial**  
**NRHP Status Code** 5D1

**Other Listings** Brockmont Park Historic District – Contributor

**Review Code**                      **Reviewer**                      **Date**

Page 1 of 2

\***Resource Name or #:** 335 W KENNETH RD

**P1. Other Identifier:**

\***P2. Location:**  Not for Publication  Unrestricted

\***a. County:** Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\***b. USGS 7.5' Quad:** Burbank    **Date:** 1966, photorevised 1972, minor revision 1994    **T R of of Sec B.M.**

c. Address: 335 W Kenneth Road

City: Glendale

Zip: 91202

d. UTM: Zone:        ;        mE/        mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-023-009

\***P3a. Description:** (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Spanish Colonial Revival

**Siding:** smooth stucco

**Roof:** hipped; clay tile; exposed rafter tails

**Windows:** wood fixed and casement windows; vinyl picture window

**Primary Entrance:** arcaded entryway with arches covered by shed roof; wood paneled door with square light; wrought-iron entry gate supported by rectangular stucco piers

**Chimney:** smooth stucco and brick with gabled chimney shroud at side façade

**Garage:** detached

**Other Notable Features:** stucco quoins at front wing; loggia with central column; arched porte cochere

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** construction of detached play room and barbecue with tile hipped roof at rear of property (1951); vinyl picture window with internal muntins at first-floor projecting wing (2011); pergola at entrance (2012)

**Integrity:** high due to retention of character-defining features

\***P3b. Resource Attributes:** (List attributes and codes) HP2. Single-family property

\***P4. Resources Present:**  Building     Structure     Object     Site     District     Element of District     Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to south, 3/27/2012

\***P6. Date Constructed/Age and Sources:**

Historic     Prehistoric     Both

1935

Los Angeles County Assessor

\***P7. Owner and Address:**

\***P8. Recorded by:** (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\***P9. Date Recorded:** January 2013

\***P10. Survey Type:** (Describe)

Historic District Evaluation

\***P11. Report Citation:**

\***Attachments:**  NONE     Location Map     Sketch Map     Continuation Sheet     Building, Structure, and Object Record  
 Archaeological Record     District Record     Linear Feature Record     Milling Station Record     Rock Art Record  
 Artifact Record     Photograph Record     Other (List):



Front and side elevation, view to south, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

**Primary #**  
**HRI #**  
**Trinomial**  
**NRHP Status Code** 5D1

**Other Listings** Brockmont Park Historic District – Contributor

**Review Code**                      **Reviewer**                      **Date**

Page 1 of 2

\***Resource Name or #:** 341 W KENNETH RD

**P1. Other Identifier:**

\***P2. Location:**  Not for Publication  Unrestricted

\***a. County:** Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\***b. USGS 7.5' Quad:** Burbank    **Date:** 1966, photorevised 1972, minor revision 1994    **T R of of Sec B.M.**

c. Address: 341 W Kenneth Road

City: Glendale

Zip: 91202

d. UTM: Zone:            ;            mE/            mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-023-002

\***P3a. Description:** (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Spanish Colonial Revival

**Siding:** smooth stucco

**Roof:** front- and side-gabled; clay tile; exposed rafter tails

**Windows:** wood and aluminum hung windows; decorative shutters at arcade (numerous windows not visible from street, most windows covered by iron security grilles)

**Primary Entrance:** entry arcade with four arches; entry steps edged with decorative tile

**Chimney:** smooth stucco at side façade

**Garage:** detached with clay tile gabled roof

**Other Notable Features:** slight projection at first floor side façade covered by clay tile pent roof; terrace above entry arcade; small front-gabled wing at right front façade

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** addition and retaining wall (1940); screen porch (1942); sliding glass door at rear side façade (1955); rear patio enclosed (1984); window grilles added (date unknown)

**Integrity:** high due to retention of character-defining features

\***P3b. Resource Attributes:** (List attributes and codes) HP2. Single-family property

\***P4. Resources Present:**  Building     Structure     Object     Site     District     Element of District     Other (Isolates, etc.)

**P5a. Photo or Drawing**



\***P5b. Description of Photo:** (View, date, accession #) View to south, 3/27/2012

\***P6. Date Constructed/Age and Sources:**

Historic     Prehistoric     Both

1935

Los Angeles County Assessor

\***P7. Owner and Address:**

\***P8. Recorded by:** (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\***P9. Date Recorded:** January 2013

\***P10. Survey Type:** (Describe)

Historic District Evaluation

\***P11. Report Citation:**

\***Attachments:**  NONE     Location Map     Sketch Map     Continuation Sheet     Building, Structure, and Object Record  
 Archaeological Record     District Record     Linear Feature Record     Milling Station Record     Rock Art Record  
 Artifact Record     Photograph Record     Other (List):

CONTINUATION SHEET



Front elevation (limited view from street), view to south, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 345 W KENNETH RD

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 345 W Kenneth Road

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-023-001

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Modern

**Siding:** horizontal wood; board-and-batten; smooth stucco; painted brick

**Roof:** hipped; composite shingle; moderately-projecting eaves with angled fascia

**Windows:** wood picture windows; steel casement windows

**Primary Entrance:** porch accented by vertical wood posts; single wood door

**Chimney:** brick at side façade

**Garage:** detached garage with hipped roof

**Other Notable Features:** narrow wood posts at entry porch; three large picture windows at front façade; fence with vertical wood at side façade

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** original garage converted to den and new garage constructed (1952)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to north, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both  
1950

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Detail of garage, view to east, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor  
Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 301 LAWSON PL

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 301 Lawson Place

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN: 5632-022-008

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Ranch

**Siding:** smooth stucco; stone; board-and-batten; vertical wood

**Roof:** cross-gabled; asphalt shingle; exposed rafter tails

**Windows:** steel fixed windows with leaded diamond panes and frosted glass with decorative wood surround at garage; metal casement windows, some with leaded diamond panes; small wood fixed window with leaded diamond panes at gabled dormer; large wood divided-light picture window at front-gabled wing

**Primary Entrance:** recessed entry; single wood door

**Chimney:** stone and brick at side façade (2)

**Garage:** attached

**Other Notable Features:** flared wing wall at front-gabled wing; dovescotes and horizontal wood at front and side gable ends; gabled dormer at front façade with vertical wood; brackets at garage window

**Plan:** asymmetrical

**No. Stories:** 1

**Alterations:** garage door replaced (date unknown)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to north, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1952

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Detail of garage wing, view to north, 3/27/2012



Front elevation, view to north, 3/27/2012



Side elevation, view to west, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 307 LAWSON PL

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 307 Lawson Place

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-022-007

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Spanish Colonial Revival

**Siding:** smooth stucco with rusticated texture

**Roof:** front- and cross-gabled, shed; clay tile

**Windows:** deeply-recessed wood divided-light casement windows; large arched wood picture window; French doors at second-floor balcony with divided lights

**Primary Entrance:** deeply-recessed arched glazed wood door with wrought-iron grille; porch with tile-clad shed roof enclosed by low stucco wall

**Chimney:** stucco with stepped top at side façade

**Garage:** detached with double replacement doors and clay-tile hipped roof

**Other Notable Features:** decorative stucco grille at second story; balcony with wood spindles supported by heavy wood beam ends; decorative window recess below balcony; pilastered window surrounds at second story; heavy decorative corbels at projecting second story; arched wing wall with metal gate at west front façade

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** rear addition (2005)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



\*P5b. Description of Photo: (View, date, accession #) View to north, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1929

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front elevation, view to north, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 1

\*Resource Name or #: 310 LAWSON PL

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 310 Lawson Place

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-023-006

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Modern

**Siding:** smooth stucco

**Roof:** shallow hipped; rolled asphalt; moderately-projecting boxed eaves

**Windows:** prominent wood divided-light picture window at front façade; rectangular sidelight with frosted glass at front entry

**Primary Entrance:** recessed brick entry porch; single wood door

**Chimney:** brick at interior

**Garage:** attached with natural wood door; garage dominates right side of front façade

**Other Notable Features:** low brick planter at front façade; small dormer vents

**Plan:** asymmetrical

**No. Stories:** 1

**Alterations:** rear addition (1953)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to south, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1951

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 311 LAWSON PL

P1. Other Identifier:

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 311 Lawson Place

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-022-006

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

Architectural Style: Colonial Revival

Siding: smooth stucco

Roof: cross-gabled, shed; asphalt shingle

Windows: wood divided-light double-hung windows with decorative shutters; wood bay with leaded glass and metal roof

Primary Entrance: wood door surround with fluted pilasters and raised bullseye details at lintel; single door with panels and rectangular lights; partial-width brick entry porch enclosed by low wall

Chimney: smooth stucco at side façade

Garage: detached with hipped roof

Other Notable Features: decorative pierced grilles at front wing; decorative attic vents at gables; decorative wood brackets below slight second-floor projection at side façade; carriage light fixture at front entry

Plan: asymmetrical

No. Stories: 2

Alterations: garage extension (1961); aluminum patio cover and screen at rear (1962)

Integrity: high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

P5a. Photo or Drawing



\*P5b. Description of Photo: (View, date, accession #) View to north, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1936

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):

CONTINUATION SHEET



Detail of front wing, view to north, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 7DNC

Other Listings Brockmont Park Historic District – Non-Contributor  
Review Code Reviewer Date

Page 1 of 1

\*Resource Name or #: 314 LAWSON PL

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 314 Lawson Place

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-023-007

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Tudor Revival

**Siding:** smooth stucco

**Roof:** hip-on-gable; asphalt shingle

**Windows:** aluminum-clad wood double-hung, casement, and fixed windows

**Primary Entrance:** gabled entry supported by wood posts; wood panel door with four-over-four lights

**Chimney:** stucco at interior

**Garage:** detached

**Other Notable Features:** porte cochere

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** window replacements; veneer stone wainscoting; half-timbering; second-floor porch infill; new stucco cladding; driveway replaced with pavers (all 2011)

**Integrity:** low due to extensive alterations

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



\*P5b. Description of Photo: (View, date, accession #) View to south, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both  
1928

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department  
Planning Division

633 E Broadway, Room 103  
Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 320 LAWSON PL

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 320 Lawson Place

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-023-008

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Ranch

**Siding:** vertical wood; stucco; stone veneer wainscoting

**Roof:** hipped; asphalt shingle

**Windows:** vinyl casement and fixed windows

**Primary Entrance:** single door with covered entry porch supported by single wood post

**Chimney:** stone at side façade

**Garage:** detached

**Other Notable Features:** stone veneer wainscoting; massive stone-clad chimney

**Plan:** asymmetrical

**No. Stories:** 1

**Alterations:** window replacements (date unknown)

**Integrity:** moderate due to loss of some character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to south, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1954

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front elevation, view to south, 3/27/2012

L State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5B

Other Listings Brockmont Park Historic District – Contributor, Glendale Register No. 66  
Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 321 LAWSON PL

P1. Other Identifier: Brougner House

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 321 Lawson Place

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-022-005

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

Architectural Style: Spanish Colonial Revival

Siding: smooth stucco

Roof: hipped, shed; clay tile

Windows: projecting two-story bay at west side of front façade with recessed arch-headed picture window, wood divided-light fixed, double-hung, and casement windows (some at second floor featuring decorative shutters)

Primary Entrance: partial-width entry porch covered by clay-tile shed roof supported by decorative beam and wood column and featuring wrought-iron railing and tiled risers at steps

Chimney: smooth stucco at side façade

Garage: arched porte cochere with wrought-iron gate; detached garage with clay tile roof

Other Notable Features: decorative corbels below projecting second floor; extensive landscaping; stucco-clad wall extends along front of large garden to east of house

Plan: asymmetrical

No. Stories: 2

Alterations: living room addition (1930); bedroom addition (1935)

Integrity: high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

P5a. Photo or Drawing



P5b. Description of Photo: (View, date, accession #) View to north, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1928

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Detail of porte cochere, view to north, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

**Primary #**  
**HRI #**  
**Trinomial**  
**NRHP Status Code** 5D1

**Other Listings** Brockmont Park Historic District – Contributor

**Review Code**                      **Reviewer**                      **Date**

Page 1 of 2

\***Resource Name or #:** 324 LAWSON PL

**P1. Other Identifier:**

\***P2. Location:**  Not for Publication  Unrestricted

\***a. County:** Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\***b. USGS 7.5' Quad:** Burbank    **Date:** 1966, photorevised 1972, minor revision 1994    **T R of of Sec B.M.**

c. Address: 324 Lawson Place

City: Glendale

Zip: 91202

d. UTM: Zone:            ;            mE/            mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-023-010

\***P3a. Description:** (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Ranch

**Siding:** board-and-batten; brick wainscoting; smooth stucco at side façade

**Roof:** hip-on-gable, shed at front projection; asphalt shingle; exposed rafter tails

**Windows:** wood double-hung windows with diamond panes at front and east façades; wood casement windows and double-hung windows with decorative shutters at west façade

**Primary Entrance:** glazed wood door

**Chimney:** clinker brick and stone at front façade

**Garage:** detached with hipped roof and scalloped fascia board at eaves

**Other Notable Features:** prominent stone and clinker brick chimney; scalloped fascia board and dovecotes in gable ends; corner windows with brackets; narrow wood posts at entry porch

**Plan:** asymmetrical

**No. Stories:** 1

**Alterations:** garage door replaced, wood shake roof replaced (dates unknown)

**Integrity:** high due to retention of character-defining features

\***P3b. Resource Attributes:** (List attributes and codes) HP2. Single-family property

\***P4. Resources Present:**  Building     Structure     Object     Site     District     Element of District     Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to south, 3/27/2012

\***P6. Date Constructed/Age and Sources:**

Historic     Prehistoric     Both

1955

Los Angeles County Assessor

\***P7. Owner and Address:**

\***P8. Recorded by:** (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\***P9. Date Recorded:** January 2013

\***P10. Survey Type:** (Describe)

Historic District Evaluation

\***P11. Report Citation:**

Smith, Francesca. Brockmont Park Historic Resources Survey. Prepared for the City of Glendale, 2011

\***Attachments:**  NONE     Location Map     Sketch Map     Continuation Sheet     Building, Structure, and Object Record  
 Archaeological Record     District Record     Linear Feature Record     Milling Station Record     Rock Art Record  
 Artifact Record     Photograph Record     Other (List):



Front and side elevation, view to south, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor  
Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 325 LAWSON PL

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 325 Lawson Place

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-022-004

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Spanish Colonial Revival

**Siding:** rough stucco

**Roof:** hipped, shed; clay tile

**Windows:** wood divided-light casement windows; wood divided-light picture window with stained glass and splayed jamb at projecting wing

**Primary Entrance:** entry porch with parabolic arches and clay-tile shed roof, square cut-out vents, stairway, and iron railing; single door

**Chimney:** stucco

**Garage:** detached with hipped clay-tile roof

**Other Notable Features:** arcaded wing wall with parabolic arch; slight second-floor projection with decorative scallop detail at east façade; balcony with shed roof above entry porch supported by exposed wood beam and spindles; square stucco pier and stepped wing wall at front façade

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** addition at rear (1937)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to north, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1932

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):

CONTINUATION SHEET



Front elevation, view to north, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor  
Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 328 LAWSON PL

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 328 Lawson Place

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-023-011

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Ranch

**Siding:** vertical wood; board-and-batten; smooth stucco

**Roof:** hipped, side-gabled; asphalt shingle

**Windows:** vinyl fixed, sliding, and greenhouse windows with internal muntins

**Primary Entrance:** recessed porch and replacement wood door with fanlight

**Chimney:** brick at end wall

**Garage:** detached with pyramid roof

**Other Notable Features:** decorative wood shutters at front window; posts at entry porch supported by brick piers

**Plan:** symmetrical

**No. Stories:** 1

**Alterations:** rear addition (date unknown); garage door replaced (date unknown); various windows replaced (date unknown)

**Integrity:** moderate due to additions visible from the street and loss of some character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to south, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1952

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Detail of detached garage, view to south, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor  
Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 329 LAWSON PL

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 329 Lawson Place

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-022-003

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Tudor Revival

**Siding:** smooth stucco; wood shiplap; half-timbering

**Roof:** hipped, side-gabled; composite shingle; exposed rafter tails

**Windows:** wood divided-light fixed, casement, and double-hung windows, some with leaded diamond panes; wood bay window with leaded diamond panes at front façade

**Primary Entrance:** brick entry porch with shed roof supported by wood posts, Tudor-arched single door

**Chimney:** smooth stucco at interior; brick at side façade

**Garage:** detached with hipped roof

**Other Notable Features:** decorative half-timbering; hipped dormers and wall dormer with casement windows and leaded diamond panes; slight second-floor projection at front façade supported by corbels

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** rear additions (1975, 1985)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to north, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1939

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front and side elevations, view to north, 3/27/2012



Front elevation, view to north, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

**Primary #**  
**HRI #**  
**Trinomial**  
**NRHP Status Code** 7DNC

**Other Listings** Brockmont Park Historic District – Non-Contributor

**Review Code**                      **Reviewer**                      **Date**

Page 1 of 2

**\*Resource Name or #:** 330 LAWSON PL

**P1. Other Identifier:**

**\*P2. Location:**  Not for Publication  Unrestricted

**\*a. County:** Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

**\*b. USGS 7.5' Quad:** Burbank    **Date:** 1966, photorevised 1972, minor revision 1994    **T R of of Sec B.M.**

c. Address: 330 Lawson Place

City: Glendale

Zip: 91202

d. UTM: Zone:                      ;                      mE/                      mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-023-012

**\*P3a. Description:** (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Ranch

**Siding:** smooth stucco; board-and-batten; brick wainscoting

**Roof:** gable-on-hip, shed; composite shingle

**Windows:** wood divided-light double-hung windows; wood divided-light picture window

**Primary Entrance:** half-width entry porch with wood posts and brackets; single door

**Chimney:** brick at front façade piercing porch roof; stucco at rear

**Other Notable Features:** chimney; shed- and gable-roofed wing at front façade

**Plan:** asymmetrical

**No. Stories:** 1 and 2

**Alterations:** large two-story addition at rear (1991)

**Integrity:** low due to extensive alterations

**\*P3b. Resource Attributes:** (List attributes and codes) HP2. Single-family property

**\*P4. Resources Present:**  Building     Structure     Object     Site     District     Element of District     Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to south, 3/27/2012

**\*P6. Date Constructed/Age and Sources:**

Historic     Prehistoric     Both

1951

Los Angeles County Assessor

**\*P7. Owner and Address:**

**\*P8. Recorded by:** (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

**\*P9. Date Recorded:** January 2013

**\*P10. Survey Type:** (Describe)

Historic District Evaluation

**\*P11. Report Citation:**

**\*Attachments:**  NONE     Location Map     Sketch Map     Continuation Sheet     Building, Structure, and Object Record  
 Archaeological Record     District Record     Linear Feature Record     Milling Station Record     Rock Art Record  
 Artifact Record     Photograph Record     Other (List):



Front and side elevation, view to south, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

**Primary #**  
**HRI #**  
**Trinomial**  
**NRHP Status Code** 5D1

**Other Listings** Brockmont Park Historic District – Contributor

**Review Code**                      **Reviewer**                      **Date**

Page 1 of 1

\***Resource Name or #:** 333 LAWSON PL

**P1. Other Identifier:**

\***P2. Location:**  Not for Publication  Unrestricted

\***a. County:** Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\***b. USGS 7.5' Quad:** Burbank    **Date:** 1966, photorevised 1972, minor revision 1994    **T R of of Sec B.M.**

c. Address: 333 Lawson Place

City: Glendale

Zip: 91202

d. UTM: Zone:            ;            mE/            mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-023-013

\***P3a. Description:** (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Spanish Colonial Revival

**Siding:** rough stucco

**Roof:** front- and side-gabled; clay tile

**Windows:** deeply-recessed, arch-headed wood picture window with iron balconet at front wing; tripartite wood fixed and casement window at front wing; French doors at porch; wood casement window with decorative leaded glass and round accent window with elaborate wrought-iron grille at second story

**Primary Entrance:** arcade porch with concrete floor; single wood door

**Chimney:** rough stucco at end wall

**Garage:** arched porte cochere adjacent to entry arcade; detached garage

**Other Notable Features:** second-story loggia with decorative arches; multi-level side-gabled roof at second story

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** rear addition and swimming pool (2005); rough stucco cladding (date unknown)

**Integrity:** high due to retention of character-defining features

\***P3b. Resource Attributes:** (List attributes and codes) HP2. Single-family property

\***P4. Resources Present:**  Building     Structure     Object     Site     District     Element of District     Other (Isolates, etc.)

**P5a. Photo or Drawing**



\***P5b. Description of Photo:** (View, date, accession #) View to north, 3/27/2012

\***P6. Date Constructed/Age and Sources:**

Historic     Prehistoric     Both

1929

Los Angeles County Assessor

\***P7. Owner and Address:**

\***P8. Recorded by:** (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\***P9. Date Recorded:** January 2013

\***P10. Survey Type:** (Describe)

Historic District Evaluation

\***P11. Report Citation:**

\***Attachments:**  NONE     Location Map     Sketch Map     Continuation Sheet     Building, Structure, and Object Record  
 Archaeological Record     District Record     Linear Feature Record     Milling Station Record     Rock Art Record  
 Artifact Record     Photograph Record     Other (List):

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 338 LAWSON PL

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 338 Lawson Place

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-023-013

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Mediterranean Revival

**Siding:** smooth stucco

**Roof:** hipped; clay tile

**Windows:** wood divided-light casement windows, some with decorative shutters; small wood double-hung windows

**Primary Entrance:** pair of wood-paneled doors with wood diamond-pane transom

**Chimney:** smooth stucco at interior

**Garage:** attached with clay-tile hipped roof

**Other Notable Features:** second-story loggia with two colonettes; pierced stucco grilles at front and side façades; single-story projecting wing at side; belt course at rear volume

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** retaining walls (1936, 1950); spa (1993); garage door replaced (date unknown)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to south, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both  
1935

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department  
Planning Division  
633 E Broadway, Room 103  
Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Side elevation, view to east, 3/27/2012



Detail of attached garage, view to east, 3/27/2012



Front elevation, view to south, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor  
Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 339 LAWSON PL

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 339 Lawson Place

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-022-001

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Colonial Revival

**Siding:** smooth stucco, horizontal wood at link between house and garage

**Roof:** hipped; asphalt shingle

**Windows:** wood divided-light double-hung and casement windows, some with decorative shutters; wood bay windows, one with metal roof; wood-and-glass doors with decorative shutters at terrace above entry

**Primary Entrance:** entry portico with Doric columns supported by square bases; recessed wood door with transom light

**Chimney:** brick at side façade

**Garage:** attached three-car garage with replacement doors

**Other Notable Features:** dentiled string course; shed dormer with six small hung windows; two-story bay window projection at side façade with wood-paneled spandrel; prominent bay with metal roof and wood multi-light windows; decorative wood railing at terrace above portico; arroyo stone wall with wood fencing across top along Merriman Drive

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** swimming pool (1937); bay window addition (1943); window addition and dormer removal (1950)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**

**P5b. Description of Photo:** (View, date, accession #) View to north, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1936

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:



\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Side elevation, view to east, 3/27/2012



Detail of arroyo stone wall, view to east, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

**Primary #**  
**HRI #**  
**Trinomial**  
**NRHP Status Code** 5D1

**Other Listings** Brockmont Park Historic District – Contributor

**Review Code**                      **Reviewer**                      **Date**

Page 1 of 2

**\*Resource Name or #:** 1503 MERRIMAN DR

**P1. Other Identifier:**

**\*P2. Location:**  Not for Publication  Unrestricted

**\*a. County:** Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

**\*b. USGS 7.5' Quad:** Burbank    **Date:** 1966, photorevised 1972, minor revision 1994    **T R of of Sec B.M.**

c. Address: 1503 Merriman Drive

City: Glendale

Zip: 91202

d. UTM: Zone:            ;            mE/            mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-024-014

**\*P3a. Description:** (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Minimal Traditional

**Siding:** smooth stucco; vertical wood in gables

**Roof:** cross-gabled; composite shingle

**Windows:** steel divided-light casement and fixed windows, some with decorative shutters; steel casement windows with leaded diamond panes windows at side façade

**Primary Entrance:** recessed entry porch with decorative iron railing and post; single door

**Chimney:** brick at side façade; brick at interior

**Garage:** attached; accessed from Kenneth Road

**Other Notable Features:** decorative attic vents in front gable

**Plan:** asymmetrical

**No. Stories:** 1

**Alterations:** garage door (date unknown)

**Integrity:** high due to retention of character-defining features

**\*P3b. Resource Attributes:** (List attributes and codes) HP2. Single-family property

**\*P4. Resources Present:**  Building     Structure     Object     Site     District     Element of District     Other (Isolates, etc.)

**P5a. Photo or Drawing**



**\*P5b. Description of Photo:** (View, date, accession #) View to west, 3/27/2012

**\*P6. Date Constructed/Age and Sources:**

Historic     Prehistoric     Both

1952

Los Angeles County Assessor

**\*P7. Owner and Address:**

**\*P8. Recorded by:** (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

**\*P9. Date Recorded:** January 2013

**\*P10. Survey Type:** (Describe)

Historic District Evaluation

**\*P11. Report Citation:**

**\*Attachments:**  NONE     Location Map     Sketch Map     Continuation Sheet     Building, Structure, and Object Record  
 Archaeological Record     District Record     Linear Feature Record     Milling Station Record     Rock Art Record  
 Artifact Record     Photograph Record     Other (List):



Detail of garage, view to east, 3/27/2012



Front and side elevation, view to north, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

**Primary #**  
**HRI #**  
**Trinomial**  
**NRHP Status Code** 5D1

**Other Listings** Brockmont Park Historic District – Contributor  
**Review Code**                      **Reviewer**                      **Date**

Page 1 of 2

\***Resource Name or #:** 1509 MERRIMAN DR

**P1. Other Identifier:**

\***P2. Location:**  Not for Publication  Unrestricted

\***a. County:** Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\***b. USGS 7.5' Quad:** Burbank    **Date:** 1966, photorevised 1972, minor revision 1994    **T R of of Sec B.M.**

c. Address: 1509 Merriman Drive

City: Glendale

Zip: 91202

d. UTM: Zone:            ;            mE/            mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-024-015

\***P3a. Description:** (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Tudor Revival

**Siding:** horizontal and vertical wood; brick veneer; smooth stucco

**Roof:** hip-on-gable; composite shingle

**Windows:** wood casement windows, some with decorative shutters and leaded diamond panes; wood double-hung window with decorative shutters and iron balconet at second story; wood bay window with metal roof at first story; fixed octagonal window near front entry

**Primary Entrance:** arch-headed glazed wood door with awning

**Chimney:** brick at front façade; brick at side façade

**Garage:** porte cochere with vertical wood siding and shed roof, detached garage

**Other Notable Features:** three gabled wall dormers with fascia and cornice molding; brick wing wall with steep pitch and arched opening at west façade

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** rear addition and fireplace (1950); swimming pool (1990); chimney repair (1997)

**Integrity:** high due to retention of character-defining features

\***P3b. Resource Attributes:** (List attributes and codes) HP2. Single-family property

\***P4. Resources Present:**  Building     Structure     Object     Site     District     Element of District     Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to west, 3/27/2012

\***P6. Date Constructed/Age and Sources:**

Historic     Prehistoric     Both

1937

Los Angeles County Assessor

\***P7. Owner and Address:**

\***P8. Recorded by:** (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\***P9. Date Recorded:** January 2013

\***P10. Survey Type:** (Describe)

Historic District Evaluation

\***P11. Report Citation:**

\***Attachments:**  NONE     Location Map     Sketch Map     Continuation Sheet     Building, Structure, and Object Record  
 Archaeological Record     District Record     Linear Feature Record     Milling Station Record     Rock Art Record  
 Artifact Record     Photograph Record     Other (List):



Front elevation, view to west, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 1515 MERRIMAN DR

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 1515 Merriman Drive

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-024-016

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** French Revival

**Siding:** smooth stucco

**Roof:** flared hipped; wood shingle

**Windows:** wood casement windows, some with decorative shutters; wood multi-light bay windows at either side of first story; French doors at second-floor balconet featuring ornate ironwork and scalloped sheet metalwork

**Primary Entrance:** pilastered door surround with half-round pediment and urn-shaped finials; wood door

**Chimney:** brick at side façade

**Garage:** porte cochere with segmental-arched opening; detached garage with hipped roof

**Other Notable Features:** gabled wall dormer with round vent; small vented dormer with hipped roof at secondary roof

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** awnings (date unknown)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



\*P5b. Description of Photo: (View, date, accession #) View to west, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both  
1937

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department  
Planning Division  
633 E Broadway, Room 103  
Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front elevation, view to west, 3/27/2012



Front elevation, view to west, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 1521 MERRIMAN DR

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 1521 Merriman Drive

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-024-017

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Spanish Colonial Revival

**Siding:** smooth stucco

**Roof:** gabled, hipped; clay tile; exposed rafter tails

**Windows:** wood picture window with segmental arch flanked by divided-light casement windows, decorative shutters, and wrought-iron planters at gabled wing; recessed wood divided-light casement windows; pair of arch-headed wood divided-light windows at first floor; small wood window covered by wrought-iron grille at first floor; wood divided-light French doors with transom at balcony

**Primary Entrance:** recessed entry with arched opening, wrought-iron gate, and tile-clad stairs; single door

**Chimney:** smooth stucco at side façade

**Garage:** detached with hipped clay-tile roof

**Other Notable Features:** wrought-iron balcony above entry door supported by decorative corbel base and flanked by stucco grilles at second story; vent with clay tile above picture window at front wing

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** garden wall (1934); rear porch enclosure (1970)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to west, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1930

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front and side elevations, view to west, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 1

\*Resource Name or #: 1525 MERRIMAN DR

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 1525 Merriman Drive

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-024-018

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Spanish Colonial Revival

**Siding:** smooth stucco

**Roof:** gabled, hipped, shed; clay tile

**Windows:** wood divided-light casement windows, one at second story with stucco surround, decorative tile, and balconet; arched picture window at first story; wood divided-light casement windows at front wing with decorative tile at sill

**Primary Entrance:** wood door with wrought-iron grille and decorative stucco surround

**Chimney:** stucco at interior

**Garage:** arcade porte cochere, detached garage with clay-tile roof and two arched doors

**Other Notable Features:** two-story octagonal tower with decorative cornice molding and clay-tile roof; octagonal cupola above tower with clay-tile roof; arched breezeway in main body of house next to porte cochere; wood lattice window grille; iron balconet with decorative tile and heavy sculpted stucco sill; low retaining wall with decorative tile and wood posts supporting porch roof at front wing; decorative corbels at second-floor eave above porte cochere

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** front balcony enclosed (1989); rear additions (1991, 1993)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to west, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1928

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front elevation, view to west, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor  
Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 1529 MERRIMAN DR

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 1529 Merriman Drive

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-024-019

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Spanish Colonial Revival

**Siding:** smooth stucco

**Roof:** gabled, hipped; clay tile; exposed rafter tails

**Windows:** aluminum sliding windows at first and second story; deeply-recessed wood divided-light picture window at front wing

**Primary Entrance:** slight recessed entry; single door

**Chimney:** smooth stucco at interior; smooth stucco and brick at side façade

**Garage:** arched porte cochere below second story; detached garage with arched doors and clay-tile roof

**Other Notable Features:** central two-story octagonal tower with clay-tile roof; decorative stucco lattice flanking picture window at front wing;

stucco grilles at second floor; decorative ledge with arches and wood corbels; low stucco courtyard wall with iron gate; arcade at front façade;

round vent in front wing gable end; parabolic arched opening in wing wall at front wing

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** porch enclosure (1970); swimming pool (1989); rear addition (1992); aluminum window replacements (date unknown)

**Integrity:** moderate due to additions visible from the street and loss of some character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to west, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1928

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Detail of front wing, view to west, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 1535 MERRIMAN DR

P1. Other Identifier:

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 1535 Merriman Drive

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-024-020

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Minimal Traditional with Tudor Revival influences

**Siding:** smooth stucco; brick; horizontal wood

**Roof:** gabled; asphalt shingle

**Windows:** metal divided-light casement windows at first and second stories, some with decorative shutters; wood divided-light picture window at west front façade

**Primary Entrance:** small entry porch; recessed glazed wood door

**Chimney:** stucco at end wall

**Garage:** attached

**Other Notable Features:** gabled roof and wall dormers with horizontal wood siding; horizontal vents in side gables; decorative wood corbels below second-story projection

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** spa (1991); garage door replaced (date unknown); skylights (date unknown)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

P5a. Photo or Drawing



\*P5b. Description of Photo: (View, date, accession #) View to west, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1950

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Detail of attached garage, view to west, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 1541 MERRIMAN DR

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 1541 Merriman Drive

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-024-021

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Spanish Colonial Revival

**Siding:** smooth stucco

**Roof:** gabled; clay tile; exposed rafter tails

**Windows:** wood divided-light double-hung windows at first and second story; recessed wood picture window at first story; vinyl sliding windows at front and side façades

**Primary Entrance:** recessed porch with beveled opening and decorative wrought-iron scrollwork, single door

**Chimney:** smooth stucco at interior

**Garage:** detached with clay-tile roof

**Other Notable Features:** veranda at second story with wrought-iron scrollwork in segmental arches; heavy corbels supporting second-story projection at primary façade; round vent in gable end; canvas awnings with spear rods at some windows

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** rear addition (1970); swimming pool (1973); various window replacements (2009)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to west, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1935

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):

CONTINUATION SHEET



Front elevation, view to west, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

**Primary #**  
**HRI #**  
**Trinomial**  
**NRHP Status Code** 5D1

**Other Listings** Brockmont Park Historic District – Contributor

**Review Code**                      **Reviewer**                      **Date**

Page 1 of 2

**\*Resource Name or #:** 1547 MERRIMAN DR

**P1. Other Identifier:**

**\*P2. Location:**  Not for Publication  Unrestricted

**\*a. County:** Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

**\*b. USGS 7.5' Quad:** Burbank    **Date:** 1966, photorevised 1972, minor revision 1994    **T R of of Sec B.M.**

c. Address: 1547 Merriman Drive

City: Glendale

Zip: 91202

d. UTM: Zone:            ;            mE/            mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-024-022

**\*P3a. Description:** (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Monterey Revival

**Siding:** horizontal wood, vertical wood, brick, stucco

**Roof:** side-gabled; composite shingle; exposed rafter tails

**Windows:** wood divided-light double-hung windows at first and second story, some with decorative wood shutters; French doors at second-story balcony

**Primary Entrance:** wood-paneled entry surround; recessed door

**Chimney:** smooth stucco at interior; painted brick at side façade

**Garage:** gated porte cochere, detached garage

**Other Notable Features:** one-story projecting wing clad with brick; inset balcony supported by decorative beam ends with criss-cross railing; brick grille in front wing; attic vents at side gables

**Plan:** symmetrical

**No. Stories:** 2

**Alterations:** wood shingle roof replaced (date unknown); gate with decorative detail at porte cochere (date unknown)

**Integrity:** high due to retention of character-defining features

**\*P3b. Resource Attributes:** (List attributes and codes) HP2. Single-family property

**\*P4. Resources Present:**  Building     Structure     Object     Site     District     Element of District     Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to west, 3/27/2012

**\*P6. Date Constructed/Age and Sources:**

Historic     Prehistoric     Both

1934

Los Angeles County Assessor

**\*P7. Owner and Address:**

**\*P8. Recorded by:** (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

**\*P9. Date Recorded:** January 2013

**\*P10. Survey Type:** (Describe)

Historic District Evaluation

**\*P11. Report Citation:**

**\*Attachments:**  NONE     Location Map     Sketch Map     Continuation Sheet     Building, Structure, and Object Record  
 Archaeological Record     District Record     Linear Feature Record     Milling Station Record     Rock Art Record  
 Artifact Record     Photograph Record     Other (List):



Front and side elevation, view to west, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 1551 MERRIMAN DR

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 1551 Merriman Drive

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-024-023

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Modern

**Siding:** smooth stucco; brick veneer

**Roof:** flat; rolled asphalt

**Windows:** vinyl sliding windows at second story, some with fixed transoms; full-height metal casement windows with transoms at first story; large vinyl sliding windows above entry door with box planter and flush, wide surround; fixed windows with wood sills on either side of entry door

**Primary Entrance:** single door

**Chimney:** brick at end wall

**Garage:** attached two-car

**Other Notable Features:** prominent vertical and horizontal molding throughout front façade; wide boxed eaves; wide window surrounds; wide entry door; panel moldings at west front façade; brick steps and planter near entry

**Plan:** symmetrical

**No. Stories:** 2

**Alterations:** swimming pool (1950); reroof (1993); rear addition (1996); window replacements (date unknown)

**Integrity:** moderate due to removal of some character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to west, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1949

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front elevation, view to west, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 1555 MERRIMAN DR

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 1555 Merriman Drive

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-024-024

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Spanish Colonial Revival

**Siding:** smooth stucco

**Roof:** hipped, gabled; clay tile; exposed rafter tails

**Windows:** recessed wood picture window at front wing; recessed wood arched casement windows at first story; wood divided-light double-hung and casement windows, some with decorative shutters

**Primary Entrance:** stucco door surround; single wood door

**Chimney:** smooth stucco at interior, smooth stucco at side façade

**Garage:** arched porte cochere with shed roof extending from house, detached garage at rear

**Other Notable Features:** terra cotta window grilles at second floor above entrance; stucco corbels below second-floor projection; corner buttress at front wing; heavy wood lintel above picture window

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** decorative shutters at second story added (date unknown)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to west, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1935

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

Smith, Francesca. Brockmont Park Historic Resources Survey. Prepared for the City of Glendale, 2011

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front and side elevation, view to west, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor  
Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 1500 VALLEY VIEW RD

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 1500 Valley View Road

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-021-001

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Monterey Revival

**Siding:** smooth stucco

**Roof:** hipped; asphalt shingle; boxed eaves; prominent dormer vents

**Windows:** wood divided-light double-hung windows with decorative shutters; French doors at second-floor balcony

**Primary Entrance:** recessed entry with pilastered surround; glazed wood door flanked by sidelights (replacements)

**Chimney:** brick at interior

**Garage:** detached with hipped roof

**Other Notable Features:** partial-width balcony with decorative iron posts and railing; iron balconet at second story; wood lintels above several openings; mature palms

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** door and sidelights (dates unknown)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to east, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1948

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Detail of garage, view to east, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor  
Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 1514 VALLEY VIEW RD

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 1514 Valley View Road

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-021-002

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Spanish Colonial Revival

**Siding:** smooth stucco

**Roof:** hipped, gabled; clay tile; exposed rafter tails

**Windows:** wood divided-light casement and fixed windows, some with decorative shutters; French doors with decorative shutters at east front façade

**Primary Entrance:** entry porch with paired, square wood posts, prominent header, and wood railing

**Chimney:** painted brick with concrete chimney cap at interior

**Garage:** attached with wood doors and clay-tile gabled roof; decorative cupola and weather vane

**Other Notable Features:** dormer attic vents with clay-tile cladding; stucco cornice below eaves at second story; breezeway between house and garage with turned wood gate; basketweave brick paving at driveway; mature palms

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** various window replacements (1952 and later)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to east, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1935

Los Angeles County Assessor

\*P7. Owner and Address:

**P8. Recorded by:** (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):

Fr  
Nt



Front elevation, view to east, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor  
Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 1520 VALLEY VIEW RD

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 1520 Valley View Road

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-021-035

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Monterey Revival

**Siding:** smooth stucco; horizontal wood

**Roof:** side gabled at two-story main body with front gable at one-story projecting wing; asphalt shingle; exposed rafter tails

**Windows:** wood bay window with divided lights and metal roof at western wall of front wing; wood casement windows featuring decorative shutters; French door with wood screen door at balcony

**Primary Entrance:** two concrete steps lead to single wood door with rectangular lights

**Chimney:** prominent brick at side façade

**Garage:** detached

**Other Notable Features:** second-story balcony with wrought-iron railing and posts supported by exposed beams; brick and concrete driveway

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** rear addition (1977); swimming pool (1983); chimney rebuilt (1997); balcony supports and railing replaced (date unknown); garage door replacement (date unknown); metal fence in front yard (date unknown)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to east, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1934

Los Angeles County Assessor

\*P7. Owner and Address:

**P8. Recorded by:** (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front and side elevation, view to east, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 1530 VALLEY VIEW RD

P1. Other Identifier:

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 1530 Valley View Road

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-021-034

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

Architectural Style: Spanish Colonial Revival

Siding: smooth stucco

Roof: hipped, gabled, shed; clay tile

Windows: wood divided-light bay window with turned wood mullions; recessed arched wood picture window with iron balconet at front wing; recessed wood divided-light casement windows; aluminum sliders at second-story addition

Primary Entrance: arched, gabled, recessed entry leads to wood door flanked by wood panels; stone steps with iron railing

Chimney: smooth stucco at interior

Garage: attached two-car garage with three arched openings (one with wrought-iron gate accessing rear yard); brick-and-stucco cupola with weather vane, flared metal roof, and decorative tile at garage

Other Notable Features: projecting second-floor volume supported by wood corbels; wing wall with arched opening and iron gate at the north side of front façade; slight second-floor projection supported by wood beam and corbels; round and rectangular accent windows covered by iron grilles at first and second floors; mature palms

Plan: asymmetrical

No. Stories: 2

Alterations: two-story rear addition (1969); one-story rear addition (1973); alterations at front entry (date unknown), garage doors replaced (date unknown), various windows replaced (1963 and later)

Integrity: moderate due to additions visible from the street and loss of some character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

P5a. Photo or Drawing



P5b. Description of Photo: (View, date, accession #) View to east, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1934

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front and side elevation, view to east, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

Primary #  
HRI #  
Trinomial  
NRHP Status Code 5D1

Other Listings Brockmont Park Historic District – Contributor

Review Code Reviewer Date

Page 1 of 2

\*Resource Name or #: 1536 VALLEY VIEW RD

**P1. Other Identifier:**

\*P2. Location:  Not for Publication  Unrestricted

\*a. County: Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\*b. USGS 7.5' Quad: Burbank Date: 1966, photorevised 1972, minor revision 1994 T R of of Sec B.M.

c. Address: 1536 Valley View Road

City: Glendale

Zip: 91202

d. UTM: Zone: ; mE/ mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-021-005

\*P3a. Description: (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Ranch

**Siding:** smooth stucco, board-and-batten

**Roof:** gable-on-hip; composite shingle

**Windows:** three steel divided-light casement and fixed windows at front façade

**Primary Entrance:** three wood posts at recessed entry; glazed wood door

**Chimney:** brick at interior

**Garage:** attached

**Other Notable Features:** board-and-batten cladding in front gable end; staggered roofline; semi-circular driveway; mature palms

**Plan:** asymmetrical

**No. Stories:** 1

**Alterations:** addition at rear (1983); reroof (1983); garage door replacement (date unknown)

**Integrity:** high due to retention of character-defining features

\*P3b. Resource Attributes: (List attributes and codes) HP2. Single-family property

\*P4. Resources Present:  Building  Structure  Object  Site  District  Element of District  Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to east, 3/27/2012

\*P6. Date Constructed/Age and Sources:

Historic  Prehistoric  Both

1954

Los Angeles County Assessor

\*P7. Owner and Address:

\*P8. Recorded by: (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\*P9. Date Recorded: January 2013

\*P10. Survey Type: (Describe)

Historic District Evaluation

\*P11. Report Citation:

\*Attachments:  NONE  Location Map  Sketch Map  Continuation Sheet  Building, Structure, and Object Record  
 Archaeological Record  District Record  Linear Feature Record  Milling Station Record  Rock Art Record  
 Artifact Record  Photograph Record  Other (List):



Front elevation, view to east, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

**Primary #**  
**HRI #**  
**Trinomial**  
**NRHP Status Code** 5D1

**Other Listings** Brockmont Park Historic District – Contributor

**Review Code**                      **Reviewer**                      **Date**

Page 1 of 1

**\*Resource Name or #:** 1542 VALLEY VIEW RD

**P1. Other Identifier:**

**\*P2. Location:**  Not for Publication  Unrestricted

**\*a. County:** Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

**\*b. USGS 7.5' Quad:** Burbank    **Date:** 1966, photorevised 1972, minor revision 1994    **T R of of Sec B.M.**

c. Address: 1542 Valley View Road

City: Glendale

Zip: 91202

d. UTM: Zone:            ;            mE/            mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-021-006

**\*P3a. Description:** (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Spanish Colonial Revival

**Siding:** smooth stucco

**Roof:** hipped, gabled; clay tile

**Windows:** large rectangular picture window with leaded glass at north wing; parabolic arched picture window at north façade of main body; replacement vinyl casement windows with simulated divided lights at most other openings

**Primary Entrance:** shed-roofed arcade with arches

**Chimney:** smooth stucco at side façade

**Garage:** attached

**Other Notable Features:** large parabolic arched gated breezeway at west façade; decorative cutouts in brick chimney; mature palms

**Plan:** asymmetrical

**No. Stories:** 2

**Alterations:** window replacements (2003); reroof (2005); round decorative medallions below cornice at several gable ends (date unknown); cast stone window surrounds at first- and second-story west façade (date unknown); garage door replaced (date unknown)

**Integrity:** moderate due to loss of historic fabric

**\*P3b. Resource Attributes:** (List attributes and codes) HP2. Single-family property

**\*P4. Resources Present:**  Building     Structure     Object     Site     District     Element of District     Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to south, 3/27/2012

**\*P6. Date Constructed/Age and Sources:**

Historic     Prehistoric     Both

1929

Los Angeles County Assessor

**\*P7. Owner and Address:**

**\*P8. Recorded by:** (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

**\*P9. Date Recorded:** January 2013

**\*P10. Survey Type:** (Describe)

Historic District Evaluation

**\*P11. Report Citation:**

**\*Attachments:**  NONE     Location Map     Sketch Map     Continuation Sheet     Building, Structure, and Object Record  
 Archaeological Record     District Record     Linear Feature Record     Milling Station Record     Rock Art Record  
 Artifact Record     Photograph Record     Other (List):



Front elevation, view to east, 3/27/12



Side elevation, view to south, 3/27/12

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

**Primary #**  
**HRI #**  
**Trinomial**  
**NRHP Status Code** 5D1

**Other Listings** Brockmont Park Historic District – Contributor

**Review Code**                      **Reviewer**                      **Date**

Page 1 of 2

**\*Resource Name or #:** 1555 VALLEY VIEW RD

**P1. Other Identifier:**

**\*P2. Location:**  Not for Publication  Unrestricted

**\*a. County:** Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

**\*b. USGS 7.5' Quad:** Burbank    **Date:** 1966, photorevised 1972, minor revision 1994    **T R of of Sec B.M.**

c. Address: 1555 Valley View Road

City: Glendale

Zip: 91202

d. UTM: Zone:            ;            mE/            mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-012-002

**\*P3a. Description:** (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Ranch

**Siding:** smooth stucco; brick wainscoting

**Roof:** side-gabled, composite shingle; staggered configuration

**Windows:** two large steel fixed picture windows flanked by casement windows with transoms above; steel casement windows at side façade

**Primary Entrance:** brick recessed entry with single wood door; decorative metal porch roof supports

**Chimney:** brick at interior

**Garage:** detached with gabled roof

**Other Notable Features:** porte cochere supported by decorative metal posts; prominent windows at front façade; semi-circular driveway; brick lamp-post and lamp

**Plan:** symmetrical

**No. Stories:** 1

**Alterations:** reroof (unknown)

**Integrity:** high due to retention of character-defining features

**\*P3b. Resource Attributes:** (List attributes and codes) HP2. Single-family property

**\*P4. Resources Present:**  Building     Structure     Object     Site     District     Element of District     Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to north, 3/27/2012

**\*P6. Date Constructed/Age and Sources:**

Historic     Prehistoric     Both

1954

Los Angeles County Assessor

**\*P7. Owner and Address:**

**\*P8. Recorded by:** (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

**\*P9. Date Recorded:** January 2013

**\*P10. Survey Type:** (Describe)

Historic District Evaluation

**\*P11. Report Citation:**

Smith, Francesca. Brockmont Park Historic Resources Survey. Prepared for the City of Glendale, 2011

**\*Attachments:**  NONE     Location Map     Sketch Map     Continuation Sheet     Building, Structure, and Object Record  
 Archaeological Record     District Record     Linear Feature Record     Milling Station Record     Rock Art Record  
 Artifact Record     Photograph Record     Other (List):



Front and side elevation, view to north, 3/27/2012

State of California — The Resources Agency  
DEPARTMENT OF PARKS AND RECREATION  
**PRIMARY RECORD**

**Primary #**  
**HRI #**  
**Trinomial**  
**NRHP Status Code** 5D1

**Other Listings** Brockmont Park Historic District – Contributor  
**Review Code**                      **Reviewer**                      **Date**

Page 1 of 2

\***Resource Name or #:** 1605 VALLEY VIEW RD

**P1. Other Identifier:**

\***P2. Location:**  Not for Publication  Unrestricted

\***a. County:** Los Angeles

and (P2b and P2c or P2d. Attach a Location Map as necessary.)

\***b. USGS 7.5' Quad:** Burbank    **Date:** 1966, photorevised 1972, minor revision 1994    **T R of of Sec B.M.**

c. Address: 1605 Valley View Road

City: Glendale

Zip: 91202

d. UTM: Zone:            ;            mE/            mN (G.P.S.)

e. Other Locational Data: (e.g., parcel #, directions to resource, elevation, etc., as appropriate) APN:5632-012-003

\***P3a. Description:** (Describe resource and its major elements. Include design, materials, condition, alterations, size, setting, and boundaries)

**Architectural Style:** Colonial Revival

**Siding:** smooth stucco; horizontal wood

**Roof:** hip-on-gable; asphalt shingle

**Windows:** wood double-hung windows at first and second floor, some featuring decorative shutters; some windows appear to be replacements

**Primary Entrance:** shed-roofed porch supported by wood posts, wood-paneled recessed entry with prominent surround and single door with 3-over-3 rectangular lights

**Chimney:** brick at front façade; brick at interior

**Garage:** semi-attached at breezeway

**Other Notable Features:** gated breezeway; prominent brick chimney at front

**Plan:** symmetrical

**No. Stories:** 2

**Alterations:** reroof (date unknown); window replacements (date unknown) new fence (2012)

**Integrity:** moderate due to additions visible from the street and loss of some character-defining features

\***P3b. Resource Attributes:** (List attributes and codes) HP2. Single-family property

\***P4. Resources Present:**  Building     Structure     Object     Site     District     Element of District     Other (Isolates, etc.)

**P5a. Photo or Drawing**



**P5b. Description of Photo:** (View, date, accession #) View to north, 3/27/2012

\***P6. Date Constructed/Age and Sources:**

Historic     Prehistoric     Both  
1940

Los Angeles County Assessor

\***P7. Owner and Address:**

\***P8. Recorded by:** (Name, affiliation, and address)

Glendale Community Development Department

Planning Division

633 E Broadway, Room 103

Glendale, CA 91206

\***P9. Date Recorded:** January 2013

\***P10. Survey Type:** (Describe)

Historic District Evaluation

\***P11. Report Citation:**

\***Attachments:**  NONE     Location Map     Sketch Map     Continuation Sheet     Building, Structure, and Object Record  
 Archaeological Record     District Record     Linear Feature Record     Milling Station Record     Rock Art Record  
 Artifact Record     Photograph Record     Other (List):



Detail of entry porch, view to north, 3/27/2012